


## The Problem

During the installation of 826376 on the Land Rover Freelander TD4, particular attention should be made to the oil seal situated behind the CSC mounting guide tube. The CSC mounting points are the same for the guide tube. Valeo has found the seal may become damaged during removal of the CSC.

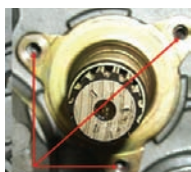

3 mounting points of CSC



Same 3 mounting points for guide tube



Rear seal condition OK



Guide tube seal found damaged

## The Cure

It is recommended that the seal is replaced before fitting the new CSC. Failure to replace the seal could lead to oil contamination of the clutch components, resulting in clutch slip.

**T.S.B. No.:**  
CL006 / 08

**PRODUCT:**  
Car Clutch

**MAKE:**  
Land Rover  
Freelander TD4

**PART No.:**  
826376

**SUBJECT:**  
Recommendations  
when fitting clutch

**DATE:**  
June 2008