



| Clutches | Pressure Plates | Different Types | Citroen Xsara Picasso 1.6 1999>

Pressure plates in two kits have different PCD's

On Citroen Xsara Picasso 1.6i 1999 > there are two different clutches that could be needed for this vehicle. The pressure plates in the two kits have different PCD's. Below are diagrams of the two covers with the differences in the bolt hole spacing labelled.

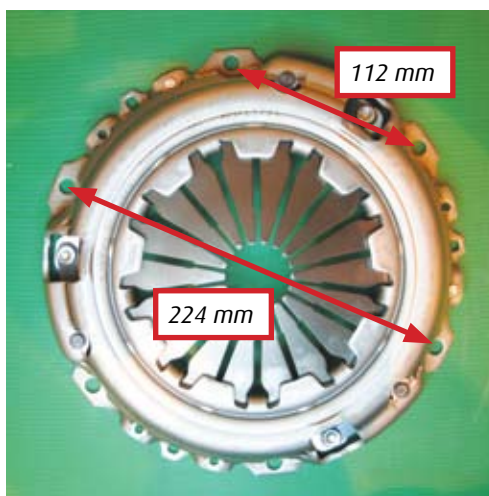

826212 clutch cover

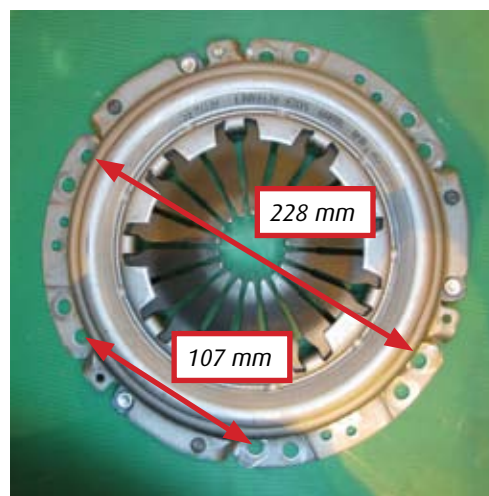

826027 clutch cover

The measurements above are taken from the centre of one bolt hole to the next bolt hole centre.

If one of the above clutches has been attempted to be fitted and the bolt holes do not line up, the other clutch above is needed.